

## **BUCHER** hydraulics

## 3.2.4 Metal tanks fitting notes


Fixing kit for metal tanks of 3,5 liters and over FIX03





Fixing bracket (q.ty 4)
Bracket spacer (q.ty 4)
M6X18 fixing bolt (q.ty 4)

Tank collar LS01 code: 200609400052



Spigot diameter 123 Height of collar 25 mm. Material: pressed steel

Provides interface between power pack housing and special tank

## Oil filler cap

Plastic material

Complete with breather

Thread: Code:

 3/8" BSP PLFT3-01
 200678000350

 1/2" BSP PLFT4-01
 200527060502

 1" BSP PLFT6-01
 200527060901







Plastic material

Complete with breather

Complete with dipstick

Thread: Code:

3/8" BSP (L=25) PLFT3-A01 200678000700 

3/8" BSP (L=81) PLFT3-A02 200678000370

3/8" BSP (L=103) PLFT3-A03 200678000380 

3/8" BSP (L=165) PLFT3-A04 200678000340

3/8" BSP (L=81) PLFT3-A05 200527099907\*

1/2" BSP (L=140) PLFT4-A01 200678000050

BSP (L=165) PLFT6-A01


\* for L050R-01


Oil filler cap

Horizontal assembling for power pack with plastic/metal tank



Important: Overhanging assembling configurations for motor or tank are not admitted

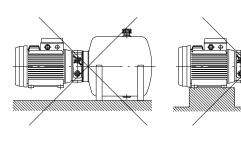






Important: For hydraulic units assembling A.C. electric motors equal or higher than 1.5 HP- 1.1KW, it's recommended to order the B34 frame size version.

200678000500

Consequently it is recommended to fix the hydraulic unit by the A.C. electric motor feet or where possible both electric motor and tank feet.

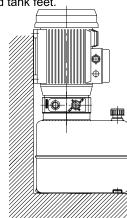

Vertical assembling for power pack with plastic/metal tanks